

## ChangeList

Date Released : 19<sup>th</sup> Nov, 2009  
Latest Firmware Version  
(For WP543 ABG) : wp543\_abg\_v112\_b091118.img  
(For WP54 ABG) : WP54\_MSSID\_V323\_B091119.IMG  
(For WPP54 ABG) : WPP54\_MSSID\_V323\_B091119.IMG

### ***Supported Hardware:***

WP54/WPP54 with WLM54G (Super/Non-Super)  
WP54/WPP54 with WLM54AG (Super/Non-Super)  
WP54/WPP54 with WLM54G-23 (Super/Non-Super)  
WP54/WPP54 with WLM54AG-23 (Super/Non-Super)  
WP54/WPP54 with WLM54G-26 (Super/Non-Super)  
WP54/WPP54 with WLM54A-26 (Super/Non-Super)  
WP54/WPP54 with WLM54G-30 (Super/Non-Super)

WC/WJ/WS with WLM54G (Super/Non-Super)  
WC/WJ/WS with WLM54AG (Super/Non-Super)  
WC/WJ/WS with WLM54G-23 (Super/Non-Super)  
WC/WJ/WS with WLM54AG-23 (Super/Non-Super)  
WC/WJ/WS with WLM54G-26 (Super/Non-Super)  
WC/WJ/WS with WLM54A-26 (Super/Non-Super)

### Note:

- a) Compex is going to release ONLY bug fixes for these products. All updates would only be considered on a case-by-case basis. Please do try our latest products, MMC/MMJ/MMS with 802.11n cards.
- b) WC/WJ/WS does not support Compression for the SuperA, SuperG, SuperA(Turbo), SuperG(Turbo) modes.

### **Changelog:**

**(For WP543 ABG) : wp543\_abg\_v112\_b091118.img**  
**(For WP54 ABG) : WP54\_MSSID\_V323\_B091119.IMG**  
**(For WPP54 ABG) : WPP54\_MSSID\_V323\_B091119.IMG**

1. Fixed: Cannot change Admin Password.  
Symptom: When you change the Admin Password, after reboot, the password still remains the same.
2. Fixed: Channel Lists are wrong in EU Countries, when select SuperA mode.  
Symptom: Leaked Channels that are not correct.

3. Fixed: Using WLM54A26 6B, using AP mode, cannot fix channels in DFS Range, using Smart Select.  
Symptom: Using SmartSelect/ Fixed Channels, the channels cannot be fixed on the board.
4. Fixed: Using WLM54A26 6B, using Client/ Transparent Client Mode, cannot scan all the channels.  
Symptom: Can only scan 4 channels. Now we can scan all the channels.
5. Added: System Identity can be shown on Mikrotik Firmware  
Symptom: Using System identity on the webpage, you can change the system identity that appears on the Mikrotik firmware.
6. Fixed: (SPECIFIC for WP54/WPP54)  
Complex is able to use space on our MAIN AP SSID. However, on the WDS, we are not able to use "space". This caused the Repeater not to be able to link up with AP if they want to use SSID to link up between AP.
7. Added: (SPECIFIC for WP54/WPP54)  
XR function is added to the Long Distance Parameters.
8. Fixed: Using All Compex 802.11a cards, in AP mode, which include:  
WLM54AG (Super/Non-Super)  
WLM54AG-23 (Super/Non-Super)  
WLM54A-26 (Super/Non-Super)  
If using DFS channels, with XR enabled, it will encounter Kernel panic.
9. Added: SuperChannel is now FREE. There is no more need to Activation Key.
10. Fixed: Using All Compex 802.11a cards, in Station mode, which include:  
WLM54AG (Super/Non-Super)  
WLM54AG-23 (Super/Non-Super)  
WLM54A-26 (Super/Non-Super)  
If using DFS channels, with XR enabled, it will hang during booting up.